



DESCRIPTION SURVEYED:
A line being described as follows:
Commencing at the Southeast corner of Section Seventeen (17), Township Six (6) North, Range Five (5) West of the 4th P.M., Town of Millville, Grant County, Wisconsin, said line being described as follows:
thence North 00° 51' 38" West 1343.84 feet along the East line of said Section to the Southeast corner of the Northeast Quarter (NE 1/4) of said Section, said corner being the point of beginning;
thence North 00° 51' 38" West 1343.84 feet along the East line of said Section to the East Quarter (E 1/4) corner;
thence North 00° 03' 24" West 2674.52 feet along the East line of said Section to the Northeast corner thereof;
thence South 89° 19' 50" West 1333.14 feet along the North line of said Section to the Northwest corner of the Northeast Quarter (NE 1/4) of said Northeast Quarter (NE 1/4);
thence South 00° 05' 26" West 2658.38 feet along the West line of the East Half (E 1/2) of the Northeast Quarter (NE 1/4) of said Section to the Southwest corner thereof and the terminus point.

SURVEYOR'S CERTIFICATE:
I, Larry L. Austin, Registered Wisconsin Land Surveyor, hereby certify:


That the above description was surveyed, mapped and monumented as shown on this plat by me or under my direct supervision.
That conformance with local ordinances are not guaranteed with this survey.
That this survey was prepared under the instructions of Arnold Steele.
That to the best of my knowledge and belief, this plat is an accurate representation thereof.
That all plans that do not show a seal imprint in red ink may contain unauthorized alterations.
The certification contained on this document shall not apply to any copies.

Dated this 24th day of May, 2010.

Larry L. Austin
Larry L. Austin, S-1903

SURVEYOR'S NOTES:
Surveyor has made no investigation for easements of record, encumbrances, restrictive covenants, ownership title evidence except as specifically shown on this plat. No distance should be assumed by scaling. No improvements have been located unless shown and noted. No representation as to ownership, use or possession should be hereon implied. Refer to abstract, title or local ordinances for any additional restriction, easements or building setback lines. No abstract, nor title commitment, nor results of title searches were furnished the surveyor.

- LEGEND**
- No. 8 x 24" rebar set with Grant County Aluminum Cap
 - ⊕ No. 8 rebar found with Grant County Aluminum Cap
 - ▲ 2" diameter iron pipe found
 - ⊠ No. 5 rebar found
 - No. 6 rebar found
 - No. 6 x 24" rebar set with cap
 - 1 1/2" x 1" x 4" Wood lath set
 - Existing T-Post with "No Trespassing" Sign
 - Existing fence location
 - - - Existing fence remnants

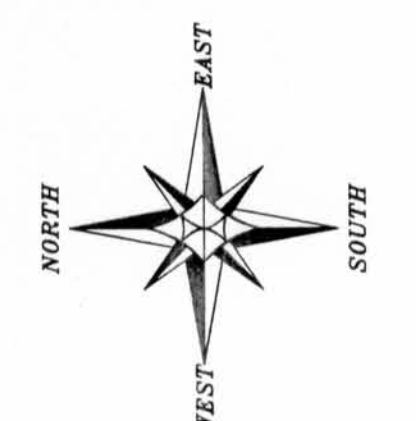

The East line of the SE 1/4 of Section 17 is assumed to bear N 00°51'38" W.
0 200 400
SCALE 1" = 200'

PLAT OF SURVEY
PREPARED FOR: ARNOLD STEELE
LOCATED IN SECTION 17, T6N R5W, TOWN OF MILLVILLE, GRANT COUNTY, WISCONSIN

Austin Engineering LLC
4211 HWY 81 E
LANCASTER, WI 53813
PHONE 608-723-6363
FAX 608-723-6702
austineengineeringllc.com

JOB NO. 10x042
FIELDBOOK: TOSR
G:\T6N R5W\18
H:\PLAT\T6N R5W\17\10x042-STEEL

DRAWN BY: AJ AUSTIN
APPROVED: LL AUSTIN
CREW: SS-SA-BD

SHEET 1 OF 1

Book 27 Page 89